


APOS 6



KONGSBERG

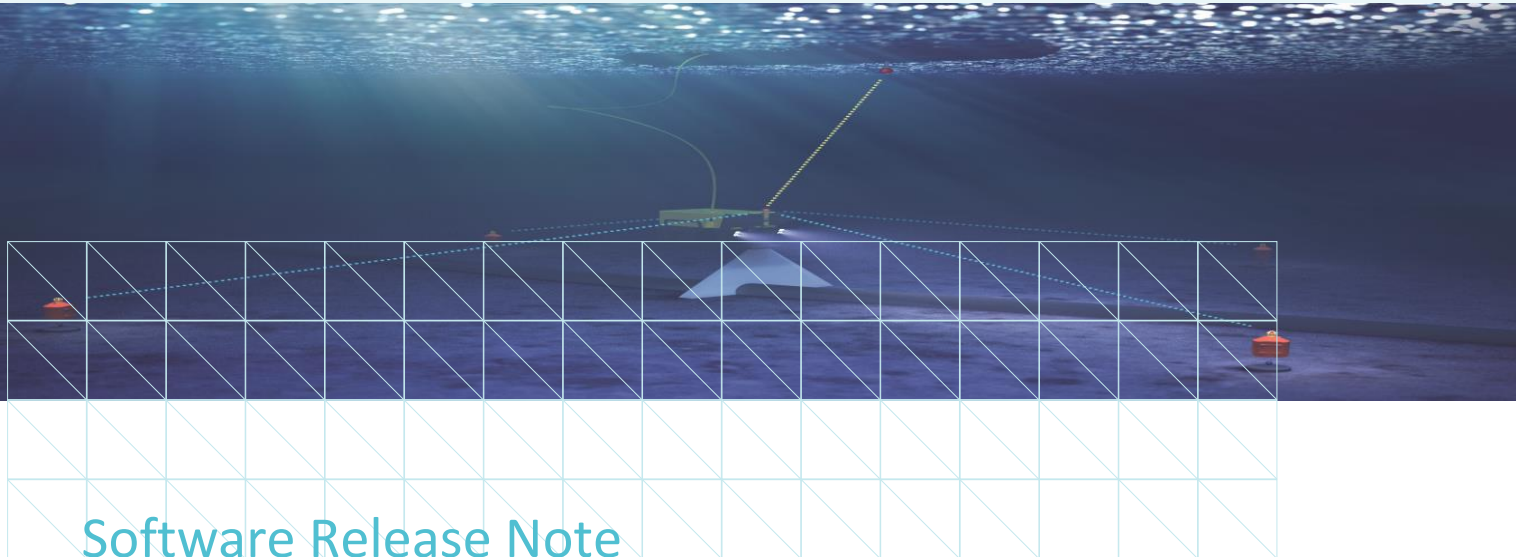

Software Release Note

User description on new functions and improvements for APOS 6 software.
Last software version is APOS 6.8.0 - 28. Aug. 2020 for Win7/10

Release Description

APOS Release 6.8.0 - 28. Aug. 2020

New functions

- TTC version 2.1.3: Added SIO-P configuration and sensor interface modem equipment option.
- Expanding the PSIMLBA, PSIMLBP and PSISSR NMEA sentences with an Age field.
- Adding additional HAIN Subsea 7k MKIII commands: set mission name, shutdown

Improvements

- Fix crash when trending attitude with no input data.
- Fix hull unit gatevalve status not showing in dialog when manual gatevalve was configured.
- Output: Changed version logging to checkbox and fix so there is a green checkmark for logging when selected.
- Fix bug in APOS report where LBL options was reported as SSBL option

APOS Release 6.7.0 - 24. March. 2020

New functions

- Added option to correct for hull unit bending due to water speed.
- Added option to calculate acoustic center offset for transceivers.
- Added support for HiPAP and APOS system report for pdf for format.
- LBL Array number is available in the PSIMLBA string
- Added support HAIN Subsea 7000 type.
- Define transceivers dialog now requires service logon instead of unique password

Improvements

- Cleanup display of calculated angle scale in TD alignment.
- Added support for cNODE Micro battery type in WinHPR and TTC.
- APOS will correctly use full screen when in full screen mode.
- Ensure the correct sounds velocity is sent to HiPAP.
- Emergency shutdown of ASI to now deactivates transponders (Win10).
- Fixed issue iff inclo offset for inclo tp is used and faulty value could be presented

APOS Release 6.6 - 05. April. 2019

New functions

- Add button for About dialog on the Acoustic page of TTC control.
- Added support for cNODE Micro battery type in WinHPR and TTC.
- Added cNODE type selection for Micro and MiniS in the new transponder dialog.
- Add button for About dialog on the Acoustic page of TTC control.
- Updated TTC to version 2.0.3. SoftwareLoader now uses the same version as the TTC control.
- Only update Tide values in sysconf when something actually changed.
- Changed MultiLBL failover functionality. Don't switch trc over to the master, but change which is master.
- OSK TimeSynch priority is now only set from IoServer and only if the time sentence input is present.
- Changed default password in SysConfEdit and WinHPR options dialog.
- Added new licensed option control

Improvements

- Tested for Win10
- Fixed issue with local transceivers not being removed correctly when synchronizing ASI on the survey side.
- Fixed ASI status lights on local transceivers to show status for local sensor when in use. Previously the status for the vessel sensor was always displayed even when local sensors were in use.

- Fixed TTC bug that caused software download to cPAP to fail.
- Remove sensor value from Numeric View when disabling a sensor on an active LBL transponder.
- Remove LBL information from Numeric View when deactivating an ROV position object.
- Fixed issue with ROV Depth not being displayed in Numeric View.
- Added position updates for Riser Monitor objects to Numeric View.
- Fixed issue with Sensor values not being shown in Polar mode in Numeric view when activated and Polar was selected.
- Fixed issue with TPRange pos objects not being properly deleted on Slave OS.
- Maintain Gyro/VRS selection for specific transceivers after a "File New" operation.
- Fixed conversion from incl x/y to and from tilt/azimuth.
- Added Internal Tilt options to the change transponder dialog in FSK mode.
- Fixed crash when tpconf window was open as transponders were deleted on a remote computer.
- Fixed bug where setting Position Source from the SparseLBL dialog did not properly subscribe to position updates from the source.
- Removed generation of VTG sentence from vessel heading to Seatex MGC.
- Fix so TdAlignment, PosFix and BoxIn save images in correct folder according to Project settings.
- Set correct error ellipse scale in LBL calibration report.
- Fixed bug in APOS report where Datasonics was reported as Wadatsumi.
- Improved issue with opening Hain Properties with no connection to the Hain computer. APOS would freeze for several seconds.
- Added missing HainControllerDefault.exe and CADImage.dll files. Opening CAD dialog would crash APOS when CADImage.dll was missing.
- Fixed crash when opening boxin utility.
- Fixed Riser Monitor NMEA output to include inclination instead of time values when inclo sensor is active.
- SoundVelocity will now use project folder to save/open xml file.
- Fixed issue where LBL positioning would stop when changing transducer even though the positioning object was active.
- Fixed an issue where td offset changes was not updated in the active graphic views on a Slave OS.
- Enabled external VRS interface for cPap transceiver.
- Fixed so that cNODE Micro and MiniS transponders show in the list of available transponders for FastTrack

Release History

APOS Release 6.5 - 01. Nov. 2018

New functions

- Added functionality to create transponders with L and M channels in Remote Control Positioning.

- Cleaned up layout of sensor options in transponder properties dialog.

Improvements

- Fixed SparseLBL lever arm properties sync between OS's.
- Prevent crash when using Interval plots in Trend View.
- Could not start the application if it was closed with more than one Trend View.
- Inclination and Temperature trends added three equal plots when the view was closed and opened again.
- When removing MultiUser LBL and LBL TP pos objects, the LBL status was not removed from Numeric View.
- Fix LBL wizard bug where LIC was not correct with extended channels.
- Add functionality to open saved TD alignment files from transponders with extended channels.
- Fix swapped Strain and Multi-SvPI sensors in new transponders dialog. When selecting Strain you got Multi-SvPI and vice versa.
- Transceiver status indicated standby instead of offline when HiPAP software was stopped.
- Fixed crash when opening UTM context menu after setting a Circle marker and Measure View was open.
- Fixed IoServer status colors with timesynch. The status was grey instead of yellow when the timesynch sentence was missing.
- Fixed switched column heading for MultiUser Master and TAD in LBL position setup dialog page.
- Fixed wrong calculation of MGC Pitch values when TP Sensor filter option was enabled in sysconf.
- Fixed software deadlock when deleting transponder and not making a selection in the following dialog for at least 30 seconds.
- Remove Altimeter option from tp properties dialog when it is not enabled in sysconf.
- Remove Attitude, Inclo and Diff.Inclo sensor options from tp config dialog when they are not enabled in sysconf.
- Pos objects added from the LBL Positioning dialog without being activated was not added to the toolbar on the Master OS.
- Subsea Transceiver status was red and said offline when everything was working.